## **ENERGY SECTOR**





# Programmable AC Current Transducer **MT418**

- TRMS AC CURRENT OR FREQUENCY MEASUREMENTS.
- **CURRENT AUTO RANGE MEASUREMENTS** UP TO 12 A.
- FREQUENCY MEASUREMENT RANGE 16 Hz 400 Hz.
- AC OR UNIVERSAL WIDE AUXILIARY POWER SUPPLY RANGE.
- ACCURACY CLASS 0.5 (EN 60 688).
- **SERIAL** (RS232 OR RS485) **COMMUNICATION**.
- SIMPLE USB SETTING WITHOUT AUXILIARY POWER SUPPLY.





#### **PROPERTIES**

- Measurements of TRMS current, frequency, THD I and MD.
- Power accuracy class 0.5.
- o Input frequency: 50 Hz / 60 Hz, 400 Hz.
- Serial communication (RS232 or RS485 up to 115,200 bit/s) and USB 2.0.
- o MODBUS RTU communication protocol.
- Universal power supply or transformer power supply.
- Automatic range (max. 12 A).
- Housing for DIN rail mounting.
- User-friendly setting software, MiQen.

#### **DESCRIPTION**

MT418 is intended for measuring and monitoring single-phase current or frequency. Current input is electrically isolated from the system by means of current transformer. It measures TRMS current value by means of fast sampling of current signals, which makes instruments suitable for acquisition of transient events. A built-in microcontroller calculates measurands (current, frequency, THD U, MD) from the measured signals. Measurands (I, f) can be then converted into load independent DC current or voltage which is proportional to the TRMS measured value for the purpose of regulation of analogue and / or digital devices.


## **APPLICATION**

The MT418 programmable AC current transducer is used for a permanent monitoring of a single-phase current and frequency values. MT418 is delivered configured to default values. Subsequent customer configuration is possible with user friendly setting software MiQen. MT418 supports standard serial RS232/RS485 with speed up to 115200 bps. USB 2.0 can be used for a fast set-up or memory acquisition (after installation USB connection is not possible any more).

Additional USB 2.0 interface can only be used for a fast setup without need for auxiliary power supply. This interface is NOT galvanically isolated from analogue output and can be used ONLY unconnected to aux. supply and measuring inputs.

## **SETTING AND ACQUISITION**

MiQen software is intended for supervision of MT418 on a PC. Network and the transducer setting, display of measured and stored values and analysis of stored data in the transducer are possible via the serial or USB communication. The information and stored measurements can be exported in standard Windows formats. Multilingual software functions on Windows 98, 2000, NT, XP, Vista, Windows 7 / 8 / 10 operating systems.

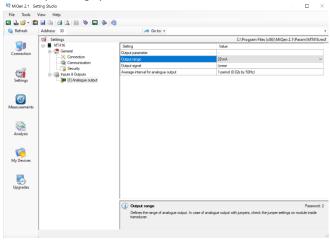

MiQen software is intended for:

- Setting all of the instruments parameters (online and offline)
- Viewing current measured readings
- Searching the net for devices
- Virtual interactive instrument
- Comprehensive help support

## **COMPLIANCE WITH STANDARDS:**

Standard EN	Description
	Safety requirements for electrical
61010	equipment for measurement,
	control and laboratory use
	Electrical measuring transducers
60688	for converting AC electrical
00000	variables into analogue and digital
	signals
61326-1	EMC requirements for electrical
	equipment for measurement,
	control and laboratory use - Part 1:
	General requirements
60529	Degrees of protection provided by
	enclosures (IP code)
60 068-2-1/ -2/ - 6/ -27/-30	Environmental testing (-1 Cold, -2
	Dry heat, -30 Damp heat, -6
	Vibration, -27 Shock)
UL 94	Tests for flammability of plastic
	materials for parts in devices and
	appliances



## **TECHNICAL DATA**

#### **Measurement input**

Nominal frequency  $(f_N)$  50 / 60 Hz

#### **CURRENT MEASUREMENTS**

Nominal values 1 A, 5 A and 10 A

Nominal current (I<sub>N</sub>) 5 A

Max. measured value 12.5 A sinusoidal

Max. allowed value (thermal) 15 A cont. Max. allowed value  $20 \times I_N$ ;  $5 \times 1s$ 

(acc. to EN 60 688)

Consumption  $< I^2 \times 0.01 \Omega$ 

#### FREQUENCY MEASUREMENT

Frequency measuring range 16 ... 400 Hz

(Only for frequency meas.)

#### **SYSTEM**

Current inputs can be connected either directly to low-voltage network or shall be connected to network via a corresponding current transformer (with standard 1 A or 5 A output).

For more information about different system connections see CONNECTION on page 6.

## Basic accuracy under reference conditions

Total accuracy (measurements and analogue output) according to EN 60 688.

Accuracy is presented as percentage of measurands nominal value except when it is stated as an absolute value. Presented accuracy is valid only for a full output range. In case if used output range is less than full output range (zoom-characteristics) see Intrinsic-error on page 5. Defined accuracy of analogue output is valid only after 45 minutes after power up, due to self-heating.

Measurand	Accuracy ( ±	% of range)
Current Trms	0.5	0.2 (1)
Frequency (f)	10 mHz	2 mHz <sup>(1)</sup>
THD (I) (0 400 %)	0.5	

<sup>(1)</sup> On Communication

#### **Communication**

MT418 has one galvanic separated communication port, which can be equipped with RS232 or RS485 or left open (to be specified with order).

Different configurations are possible (to be specified with order):

Configuration	сом
WO	USB (2)
RS232	RS232 + USB (2)
RS485	RS485 + USB (2)

(2) Please read WARNING below

Serial communication:	RS232	RS485	
Connection type	Direct	Network	
Connection terminals	Screw terminals		
Function	Settings, measurements and		
runction	firmware upgrade		
Insulation	Protection class I, 3.3 kV <sub>ACTRMS</sub> 1		
ilisulation	min		
Max. connection length	3 m	1000 m	
Transfer mode	Asynchronous		
Protocol	MODBUS RTU		
Transfer rate	2.4 kBaud to 115.2 kBaud		
Default settings	#33 \ 11520 \ N \ 8 \ 2		
Number of bus stations	/	≤ 32	

Additionally, MT418 has a USB communication port, located on the bottom, behind removable cap. When connected to this communication port MT418 is powered by USB.

#### **WARNING:**

USB communication port is NOT galvanically isolated and can ONLY be used unconnected to aux. supply AND measuring inputs.

After installation of instrument on DIN rail, USB port is not accessible any more.



USB:	
Connection type	Direct
Connection terminal	USB-mini
Max. connection length	3 m
Function	Settings and records
	acquisition, firmware upgrade
Isolation	None, directly coupled with
	analogue output
Transfer mode	Asynchronous
Protocol	MODBUS RTU
Transfer rate	USB 2.0
	USB communication port is
	NOT galvanically isolated and
	can ONLY be used
	unconnected to aux. supply
	AND measuring inputs.

The USB cover should not remain open. It should be closed immediately after the initial setting through USB port was done and should remain closed during all time of storing & operation. If unit operates without USB cover the warranty is void.

## **Output module**

#### **ANALOGUE OUTPUT**

Each of up to one unipolar analogue output is fully programmable and can be set to any of 6 full-scale ranges (4 current and 2 voltage) without opening an instrument. They all use the same output terminals.

#### **Programmable DC current output:**

Output range (0 ... 100 %)

0 1 mA	Range 1
0 5 mA	Range 2
0 10 mA	Range 3
0 20 mA	Range 4
a Albana mana ana ana ana shalla	l N 4: O

other ranges possible by MiQen software

Max. burden voltage 10 V

External resistance  $R_{B max} = 10 \text{ V} / I_{outN}$ 

#### **Programmable DC voltage output:**

Output range (0 ... 100 %)

0 ... 1 V Range 5 0 ... 10 V Range 6

Other ranges possible By MiQen software

Max. burden current 20 mA

External resistance  $R_{B min} = U_{outN} / 10 \text{ mA}$ 

General:

Max. current on output 33 mA

(short circuit voltage output)

Linearization Linear, Quadratic

No. of break points 5

Output value limits  $\pm$  120 % of nominal output

Response time <sup>(3)</sup> < 100 ms

(measurement and

analogue output)

Response time of fast (3)  $\leq 50 \text{ ms}$ 

analogue output

Residual ripple < 1 % p.p. Residual ripple of fast < 2 % p.p.

analogue output

(3) Response time for frequency is:

Typical: 300 ms Max; (freq. change > 10 Hz): 3000 ms

The output may be either short or open-circuited. It is electrically isolated from all other circuits.

All output range values can be altered subsequently (zoom scale) using the setting software with a supplementary error (see Intrinsic-error on page 5).

## Aux power supply

Universal power supply

Nominal voltage AC range 48 ... 276 V Nominal frequency range 45 ... 65 Hz Nominal voltage DC range 20 ... 300 V Consumption < 5 VA Power-on transient current < 20 A; 1 ms

#### TRANSFORMER POWER SUPPLY

Nominal voltage AC 110 V, 230 V Nominal frequency range 45 ... 65 Hz Consumption <5 VA

#### **SAFETY**

Protection: protection class II

Pollution degree 2

Installation category CAT III; 600 V<sub>±</sub> meas. Inputs

Universal aux. power supply CAT III; 300 V<sub>1</sub> Transformer aux.

power supply

CAT III; 600  $V_{\perp}$  aux. AC supply

Acc. to EN 61010-1

Test voltages I Input↔Output, UAUX, COM:

5200 V<sub>ACTRMS</sub>

Transformer aux. power supply U<sub>AUX</sub>↔Output: COM: 5200

V<sub>ACTRMS</sub>

Universal aux. power supply

 $3500 \ V_{\text{ACTRMS}}$ 

Output ← COM 500 V<sub>ACTRMS</sub>

Enclosure material PC / ABS

Acc. to UL 94 V-0

Enclosure protection IP20



#### **MECHANICAL**

 $\begin{array}{ll} \text{Dimensions} & \text{W45} \times \text{H75} \times \text{D105} \text{ mm} \\ \text{Mounting} & \text{Rail mounting 35} \times \text{15} \text{ mm} \end{array}$ 

acc. to DIN EN 50 022

Enclosure material PC / ABS

Vibration withstand 0.7 g, 3 ... 100 Hz, 1 oct / min

10 cycles in each of three

axes

Shock withstand 300 g, 8 ms pulse

6 shocks in each of three axes

Flammability Acc. to UL 94 V-0

Weight Transformer aux.power

supply 370 g

Universal aux.power supply

170 g

Enclosure protection IP 20

#### **ENVIRONMENTAL CONDITIONS**

Ambient temperature usage group II

0 ... <u>15...30</u> ... 45 °C Acc. to IEC / EN 60 688

Operating temperature  $-30 \text{ to} + 70 ^{\circ}\text{C}$ Storage temperature  $-40 \text{ to} + 70 ^{\circ}\text{C}$ Temperature coefficient  $\pm 0.1 \%$  per 10  $^{\circ}\text{C}$ 

Average annual humidity  $\leq$  93 % r.h. Altitude  $\leq$  2000 m

#### REFERENCE CONDITIONS

 $\begin{array}{lll} \mbox{Ambient temperature} & 0 \dots 45 \ ^{\circ}\mbox{C} \\ \mbox{Relative humidity} & \leq 93 \ \% \ r.h. \\ \mbox{Current input} & 0.31 \dots 5 \ A \\ \mbox{Frequency} & 45 \dots 65 \ Hz \\ \mbox{Waveform} & \mbox{Sinus} \end{array}$ 

## **INTRINSIC-ERROR (FOR ANALOGUE OUTPUT)**

For intrinsic-error for analogue output with bent or linear-zoom characteristic multiply accuracy class with correction factor (c). Correction factor c (the highest value applies):

Linear characteristic:


$$c = \frac{1 - \frac{y_0}{y_e}}{1 - \frac{x_0}{x_e}} \quad or \quad c = 1$$

Bent characteristic:

$$x_{h-1} \le x \le x_h$$

b – number of break point (1 to 5)

$$c = \frac{y_b - y_{b-1}}{x_b - x_{b-1}} \cdot \frac{x_e}{y_c}$$
 or  $c = 1$ 

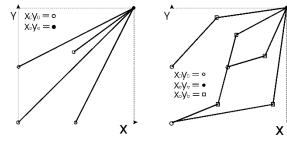

Limit of the output range

Examples of settings with linear and bent characteristic.




## **CONNECTION**

System/ connection	Terminal assignment
Single-phase connection 1b (1W)	1 3 3 4 5 6 2 2 2 2 3 4 4 5 6 2 1 2 2 2 3 4 5 6 2 1 2 2 2 3 4 5 6 2 1 2 2 2 3 4 5 6 6 2 1 2 2 2 3 4 5 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6

#### **CONNECTION TABLE**

Function			Connection
Measuring input	AC current	Ιω	1/3
Analogue output		+ ω	15
		- ω	16
Auxiliary power supply		+ / AC	13
		-/AC	14
Communication	RS232/RS485	Rx / A	21
		GND/C	22
		Tx / B	23

## **DIMENSIONAL DRAWING**

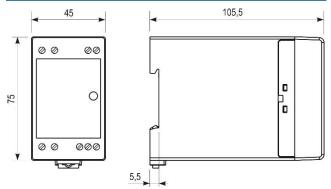

Dimensions for MT418.

## **DATA FOR ORDERING**

When ordering MT418, all required specifications should be stated in compliance with the ordering code. Additional information could be stated regarding functionality of analogue outputs. Default settings for analogue output provided that no ordering information is given will be:

Input quantity	Output quantity
lin: 0 5 A	lout: 0 20
	mA

If different analogue output settings are required, a proper input quantity / output quantity pair for each analogue output should be provided.

#### **EXAMPLE OF ORDERING**

Example of ordering code for MT418: Nominal frequency 45 ... 65 Hz; High power supply; Without communication COM1; Analogue output; Standard finish.


MT418 S U N H A




\* - standard

## **General ordering code**

All specifications are obligatory except function of analogue output(s), which should be stated in a form of description.

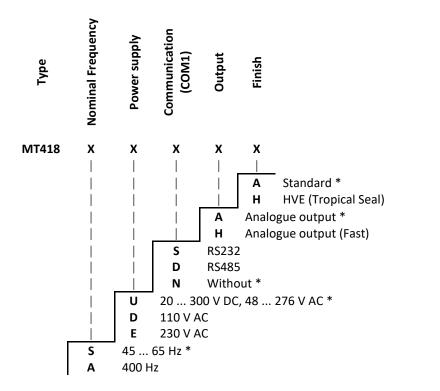

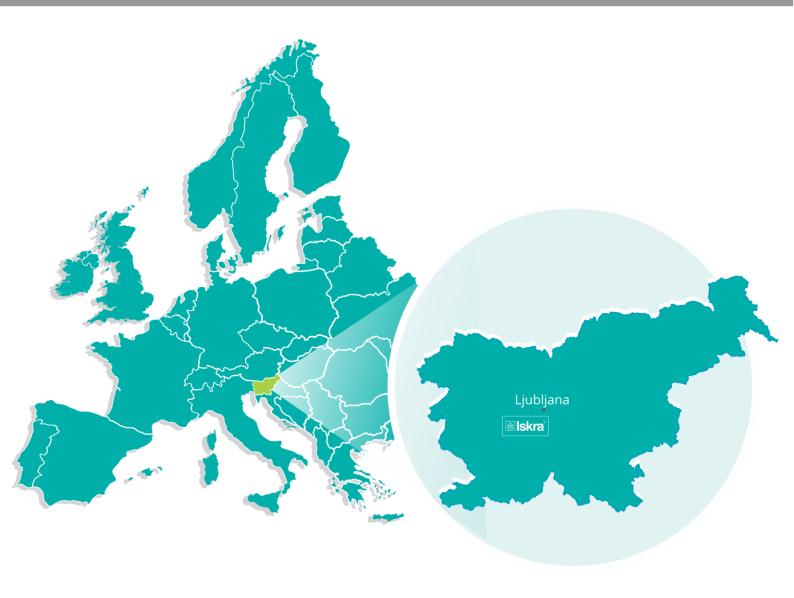

#### Iskra, d.o.o. **BU** Ljubljana Stegne 21

SI-1000 , Ljubljana Phone: + 386 1 513 10 00

#### Iskra IP, d.o.o.

Vajdova ulica 71 SI-8333, Semič Phone: +386 7 384 94 54

#### Iskra Sistemi - M dooel

Ul, Dame Gruev br. 16/5 kat 1000 , Skopje Phone: +389 75 444 498

#### Iskra, d.o.o. **BU Capacitors**

Vajdova ulica 71

SI-8333, Semič Phone: +386 7 38 49 200

#### Iskra STIK, d.o.o.

Ljubljanska cesta 24a SI-4000, Kranj Phone: +386 4 237 22 33

#### Iskra Commerce, d.o.o. Hadži Nikole Živkoviča br. 2

11000, Beograd Phone: +381 11 328 10 41

#### Iskra, d.o.o. **BU MIS**

Ljubljanska c. 24a SI-4000, Kranj Phone: +386 4 237 21 12

#### lskra Lotrič, d.o.o.

Ljubljanska c. 24a SI-4000, Kranj Phone: +386 4 237 21 12

#### Iskra Hong Kong Ltd.

33 Canton Road, T.S.T. 1705, China HK City Phone: +852 273 00 917

## Iskra, d.o.o. **BU Batteries & Potentiometers**

Šentvid pri Stični 108 SI-1296, Šentvid pri Stični Phone: +386 1 780 08 00

#### Iskra ODM, d.o.o.

Ljubljanska c. 24a SI-4000, Kranj Phone: +386 4 237 21 12

#### Iskra, d.o.o. **BU Electroplating** Glinek 5

SI-1291 , Škofljica Phone: +386 1 366 80 50

#### Iskra Tela L, d.o.o.

Omladinska 66 78250 , Laktaši Phone: +387 51 535 890

